

Ms. Ref. No : nhess-2017-141-R1 (*Natural Hazards and Earth System Sciences*)

Author(s) : Ahmet Can Altunışık and Ali Fuat Genç

Title : Earthquake Response of Heavily Damaged Historical Masonry Mosques after Restoration

ANSWERS TO THE COMMENTS:

First of all, we would like to thank the editor and reviewers for their helpful comments and contributions to our study. We have tried to answer the number of points that the editor and reviewers have outlined. These points are discussed below following the editor and reviewers' comments. We hope that the points amended in the paper comprehensively would be satisfactory enough to correspond the comments of the editor and reviewers.

Comments: This paper presents a detail investigation about the structural dynamic response of masonry mosques, which was nearly collapsed after earthquake, after restoration studies. This is very interesting, well written and organized paper. This paper will be very useful for academic researchers and project engineers related to this subject. The reviewer recommends the *publication of the paper* after minor revisions given in below in Natural Hazards and Earth System Sciences.

Reviewer 1: Fig. 1 should be removed. The earthquake region can be stated as one sentence in related places.

Answer: *According to the reviewer suggestions, Fig. 1 is deducted. This point is ordered in the revised paper.*

Reviewer 1: The section “Structural analyses of the mosque with 8 window openings” should be removed to avoid the repetition. It is shown that the results can be summarized in Tables 3 and 4 for better understanding.

Answer: *According to the reviewer suggestions, the section is deducted to better understanding and avoid the repetition. This point is ordered in the revised paper.*

Reviewer 1: The conclusion part of the paper should be shortened. Only main results should be given.

Answer: *According to the reviewer suggestions, the conclusion part of the paper is revised as:*

“In this study restoration effects on the earthquake behaviour of masonry mosques is investigated with considering different opening ratios on dome. As a result of the study the following observations were made:

- Reductions of window openings are caused an increase on frequencies. This situation shows that reduction of window openings affects the structural and stability of the mosque positively.*
- When the stress results are examined it is seen that compression and shear stresses values don't exceed the recommended compression and shear stresses values for masonry structures in the Turkish Earthquake Code (2007).*
- Tension stresses are occurred at near openings, bottom of walls and under the dome areas locally for each case.*
- Compression stresses, tension stresses and shear stresses collects some critic areas which are especially near openings and crossing points because of this, those areas must construct as monolithic in restoration process. FRP strengthening can be used for to resist the tension stresses in restoration applications.*
- According to the results, the displacements, compression, tension and shear stresses decrease when the openings reduced.*

Consequently, the reduction of window openings ensures integrity on the walls, so this situation supports the structural performance of the mosque. It is seen from the study that restoration applications, especially reduction of the window openings on dome are improves the earthquake response of the mosque.”

This point is ordered in the revised paper.

Earthquake Response of Heavily Damaged Historical Masonry Mosques after Restoration

Ahmet Can Altunışık¹, Ali Fuat Genç¹

¹Department of Civil Engineering, Karadeniz Technical University, Trabzon, 61080, Turkey

5 *Correspondence to:* Ahmet Can Altunışık (ahmetcan8284@hotmail.com)

Abstract. Restoration works have been accelerated substantially in Turkey in the last decade. Many historical buildings, mosques, minaret, bridges, towers etc. structures are restored. With these restorations an important issue arises, namely how restoration work affects the structure. For this reason it is aimed to investigate the restoration effect on the earthquake response of a historical masonry mosque with considering the openings on masonry dome. For this purpose, Hüsrev Pasha Mosque which is located in Ortakapı district
10 in old city of Van, Turkey. The region of Van is in an active seismic zone therefore earthquake analyses were made in this study. Firstly finite element model of the mosque was constructed considering the restoration drawings and 16 window openings on dome. Then model was constructed with 8 window openings. Structural analyses were made under dead and earthquake loads and Mode Superposition Method was used in analyses. Maximum displacements, maximum-minimum principal stresses and shear stresses are given with contours diagrams. The results are investigated according to Turkish Earthquake Code (2007) and compared between 8 and
15 16 window openings cases. The results show that reduction of the window openings affected the structural behaviour of the mosque positively.

1 Introduction

Masonry is the oldest and a common construction technique in the world. It is a sustainable, easy and economical construction method but its share of the construction market has decreased in recent decades (Salmanpour et al., 2015). This
20 is because about new construction techniques. Even though many constructions technic have been developed and used in the last century, almost all historical structures all over the world made up with unreinforced masonry (Chisari et al., 2015). In the course of time masonry structures have been affected heavily by natural and man-made disasters. But one of the most destructive factor is earthquake. Earthquake creates horizontal load and causes tensile stress at masonry structures which have very low tensile strength. So it is of vital importance to investigate the earthquake behavior of the masonry structures.
25 Earthquake behavior of masonry structures are related to some parameters like material properties, shape of structure, support and load situations etc. Beside these an important factor there is exist in masonry structures namely openings in masonry walls. It is commonly accepted that the presence of openings reduces the lateral stiffness and strength of the infilled system (Chen and Liu, 2015). However it has still on conflict that how the openings are located in the systems and how

openings affect the earthquake behavior of system. There are few studies made by researchers about this subject. In the Turkish Earthquake Code (TEC, 2007) there is some information about openings in masonry but those are very limited.

There are many studies exist in the literature for masonry buildings like mosque, church, minaret and tower. Researchers investigated the masonry buildings different aspects but almost never studies exist in literature about openings in masonry.

5 Mohebkhah et al. (2008) studied nonlinear analyses of masonry-infilled steel frames with openings using discrete element method. Shariq et al. (2008) investigated the influence of openings on seismic performance of masonry building walls. Lin et al. (2012) investigated structural behavior of the wall-diaphragm connections for older masonry buildings with experiments. Parisi et al. (2013) assessed rocking response of in-plane laterally-loaded masonry walls with openings. Chen and Liu (2015) investigated the in-plane behavior and strength of concrete masonry infills with openings.

10 Mosques which have beautiful appearance and high religious value are very important for Muslims. Many mosques have been built in Muslims area and most of them were built with masonry technics. There are lots of masonry mosques in Turkey and most of these mosques are especially on seismic zones. The presence of earthquakes in Turkey caused damage and destructions on masonry mosques. Also Hüsrev Pasha Mosque which was located in active seismic zone was damaged from some seismic events. In the restoration of Hüsrev Pasha Mosque there is being applied an application which is about
15 reduction of window openings on dome for to improve the structural performance. So it is required to investigate this case. For this purpose the restoration effect also reduction of window openings effect on the earthquake response of masonry mosques are investigated in this paper.

2 Hüsrev Pasha Mosque

Hüsrev Pasha Mosque is located in Ortakapı district in old city of Van, Turkey. The mosque was built by Köse Hüsrev
20 Mehmed Pasha which was governor of Van and vizier of Süleyman the magnificent. The mosque had been constructed by famous Turkish architect Mimar Sinan between 1567 and 1568.

The mosque has one big and five small domes. The big ones and the smalls covered main prayer area and last prayer area respectively. Main prayer area has 15.00m x 15.20m geometric shape and the walls which surround this area is 2m. The walls consist of cut stone and rough stones, transition elements and domes consist of bricks material. Limestone was used for
25 bonding in the walls. The mosque has a minaret which has square shape base and cylindrical body. There were china at the walls up to 2m height and pencil arts on the dome in the mosque but most of them haven't reached today. Exterior parts of the mosque have colorful stonemasonry namely red-white stones up to underside of windows and black-white stones rest of the walls with red ribbon. There is an historical inscription above the mosque's door.

The mosque is located at an active seismic region and classified as second degree earthquake zone in the Seismic Zoning
30 Map which was published by the Ministry of Public Works and Settlement of Turkey in 1996. Because of this characteristic the mosque was damaged severely by earthquakes. The mosque and social complex which had served for centuries were damaged by 1839 earthquake and fire. After this sadness event the complex was renewed. During the World War I the

complex and mosque were vandalised heavily. Beside these events the complex and mosque were ruined by 2011 Van Earthquakes. The minaret and last prayer area were heavily damaged in these earthquakes. Today the prayer area and shrine are healthy but rest of the complex highly damaged or destroyed. For this reason the mosque was closed for praying and it is aimed to open the mosque for praying with restoration project. Undamaged views of the mosque are given in Fig. 1.



5 **Figure 1: Undamaged view of Hüseyin Pasha Mosque and social complex (URL-1).**

Today there are some cases which affect the structural performance of the mosque detrimentally. These cases are structural cracks, material deformations, destroyed parts of carrier system, environmental issues-algae and humidity. Some views of these cases and damaged views of the mosque are shown in Fig. 2.



10 **Figure 2: Damaged views of Hüseyin Pasha Mosque.**

3 Structural Analysis of the Mosque

Finite element analyses were made for investigate the restoration effect on the earthquake behaviour of the mosque considering different opening ratios on dome. The model was constituted with restoration drawings considering 8 and 16 openings on dome. Finite element models of the mosque were created with SAP2000 software (SAP2000, 2015). Earthquake

analyses were affected x, y, z directions for better comprehend the restoration effect with different openings on dome. After analyses maximum displacements, maximum-minimum principal stresses and shear stresses were obtained and results are given with contour diagrams. Structural analyses of the mosque with 16 and 8 window openings are listed below:

- *Modal analysis of the mosque*
- 5 • *Dead load and earthquake load (x, y, z direction)*

Finite element models of the mosque were constituted with using bar, area and 3D solid elements in SAP2000 program. The bar, area and 3D solid elements have 2, 4 and 12 nodes respectively and each node has three degrees of freedom.

Linear elastic methods cannot give exact solutions in the structural analyses of historical masonry structures which are built with brick and stone masonry. Despite that, nonlinear analyses can give exact results if material properties of masonry are defined in analyses correctly. But if the analysed structures are very big and complex there could be some problems at iterations in nonlinear analyses. Also defining the material properties of masonry structures are fairly difficult because of their non-homogeneity. For these reasons all analyses were made as linear elastic. Material properties which were used in the analyses are given with Table 1.

Table 1 Material properties of Hüsrev Pasha Mosque

Carrier System Components		Material Properties		
		Modulus of Elasticity (N/m^2)	Poisson Ratio (-)	Density (kg/m^3)
Prayer Location	Cut Stones	1.60E09	0.200	2000
	Artless Stone (<i>with considering the mortar</i>)	4.50E08	0.200	2400
	Brick	1.20E09	0.200	2400
Outer Part of	Cut Stones	1.60E09	0.200	2000
Prayer Location	Marble	3.54E10	0.316	2690
	Stretcher	2.00E11	0.300	7850

15 Finite element analyses results; displacement, section effect and stress values were controlled with considering the allowed values in 2007 Turkish Earthquake Code (TEC, 2007)-Chapter 5.3(Pressure Safety Stresses of Walls in which Free Pressure Strength is Unknown). Safety stresses for Husrev Pasha Mosque are given below in Table 2.

Table 2 Safety stresses of materials.

Materials	Material Properties		
	Pressure Safety stresses (MPa)	Tension Safety stresses (MPa)	Shear Safety stresses (MPa)
Brick	2.40	0.360	1.05
Stone wall	0.90	0.135	0.53
Arches	0.90	0.135	0.53

Mode Superposition Method was used in earthquake analyses and elastic behaviour of the mosque under vertical and earthquake loads were obtained with using the full square consolidation method. Spectral acceleration coefficient was taken as $S(T)=2.5$ and effective earthquake coefficient was chosen as $A_0=0.3$ for related the region which is in second seismic zone. In masonry structures when the tension stresses reached the tension strength of material, cracks and weakness occur.

This situation is taken into consideration in the analyses with using the earthquake load reduction coefficient (R_a) in each period. There is no reduction made in this study ($R_a=1$) but safety stresses are enlarged with 3.

Hüsrev Pasha Mosque wasn't built with considering any building code; it was also built with experience. There are some rules about openings for masonry in the Turkish Earthquake Code (2007). When the mosque is assessed with considering these rules, there has no discrepancy with code. Some rules which are exist in the code about openings for masonry related to this study given below (TEC, 2007):

- Plan length of the solid masonry wall which is between the corner of a building and the nearest window or door opening shall not be less than 1.50 m for the first and second seismic zones and 1.0 m for the third and fourth seismic zones.
- Plan length of the solid masonry wall which is between window and door openings shall not be less than 1.0 m for the first and second seismic zones and 0.8 m for the third and fourth seismic zones.
- Except for the corners of buildings, plan length of a solid masonry wall which is between intersection of the walls and the nearest window or door opening to the intersection of the orthogonal walls shall not be less than 0.50 m in the all seismic zones.
- Plan length of each window or door opening shall not be more than 3.0 m.

3.1 Structural analyses of the mosque with 16 window openings

The mosque has 16 window openings before the restoration so finite element model of the mosque was constituted with 16 window openings. The model of the mosque has 27297 nodes, 127 bar elements, 25653 area elements and 102460 3D solid elements. Finite element model of the mosque with 16 window openings is shown in Fig. 3.

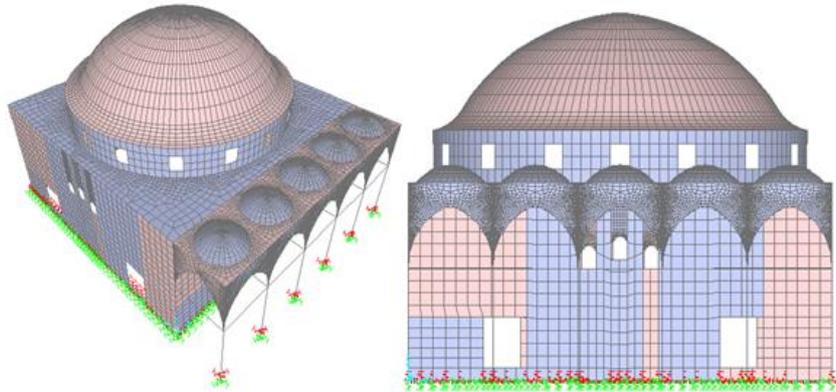


Figure 3: Finite element model of the mosque with 16 window openings.

3.1.1 Defining the dynamic characteristics and modal analysis of the mosque with 16 window openings

Dynamic characteristics were obtained with modal analysis. %5 damping ratio was used in the analysis. 20 mode shapes were obtained after analyses. First four mode shape and frequency are given with Fig. 4.

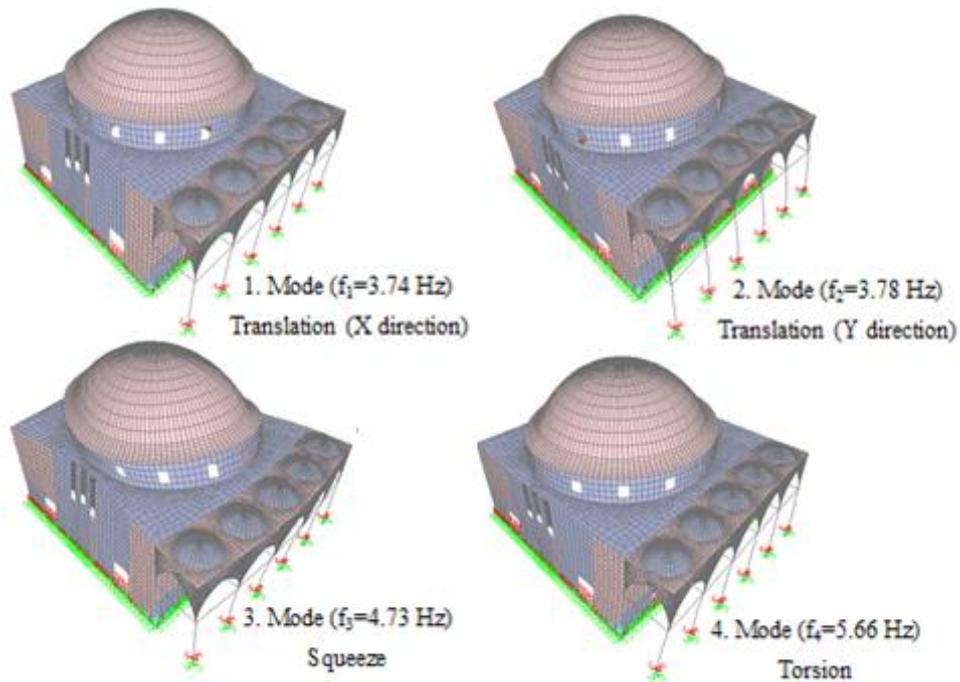


Figure 4: First four mode shape and frequency.

3.1.2 Structural response of the mosque with 16 window openings under dead load and horizontal earthquake load (G+EX)

The maximum displacements contour diagram of Hüsrev Pasha Mosque with 16 window openings under dead load and earthquake load (G+EX) is shown in Fig. 5. It can be seen from the Figure 5 that the maximum displacement occurred at the middle point of the big dome as 42.0 mm. Beside this displacements have a decreasing trend from top of the dome to lower part of the mosque.

The maximum tensile stresses contour diagram is shown in Fig. 6. It is seen from the Figure 6 that maximum values of the tensile stresses for outer surface of the mosque occurred at side and lower part of big dome, near the window spaces and transition areas of between side walls as 1.05 MPa. Maximum tensile stresses for inner surface of the mosque occurred as 1.00 MPa.

The maximum compression stresses contour diagram for outer and inner surfaces of Hüsrev Pasha Mosque with 16 window openings under dead load and earthquake load (G+EX) is shown in Fig. 7. It is seen from the Figure 7 that maximum values of the compression stresses for outer surface of mosque occurred at between the dome and side walls transition areas and near window spaces at dome as 2.05 MPa. Beside this maximum compression stresses for inner surface of the mosque, occurred as 1.85 MPa.

The maximum shear stresses contour diagram for outer and inner surfaces of Hüsrev Pasha Mosque under dead load and earthquake load (G+EX) is shown in Fig. 8. It is seen from the Figure 8 that maximum values of the shear stresses for outer and inner surfaces of the mosque are 0.65 MPa and 0.60 MPa respectively.


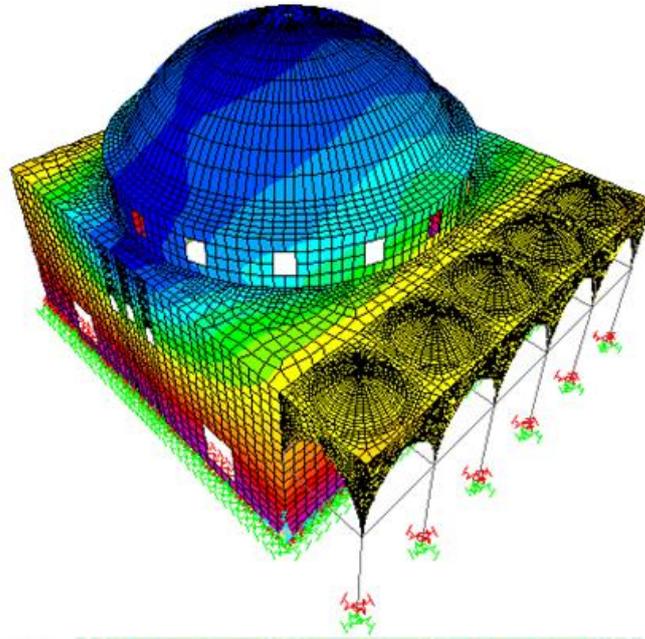


Figure 5: Maximum displacements contour diagram of the mosque with 16 window openings under dead load and earthquake load (G+EX).

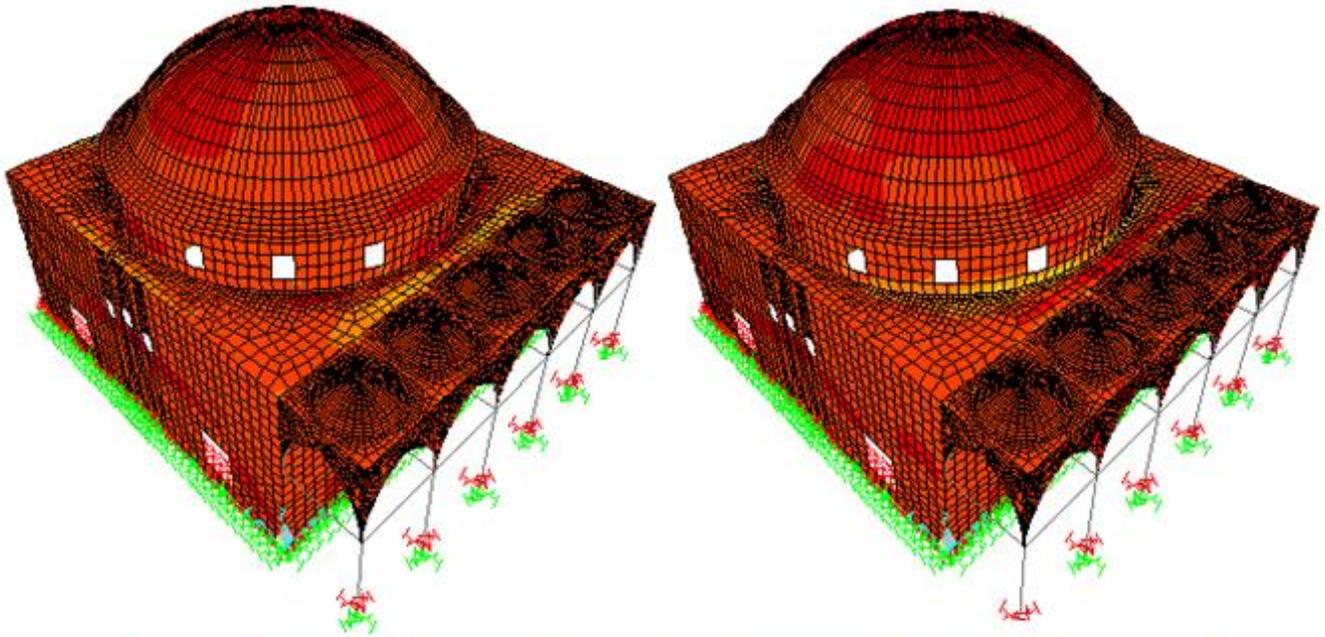

5 Figure 6: Maximum tensile stresses contour diagram for outer and inner surfaces of the mosque with 16 window openings under dead load and earthquake load (G+EX).


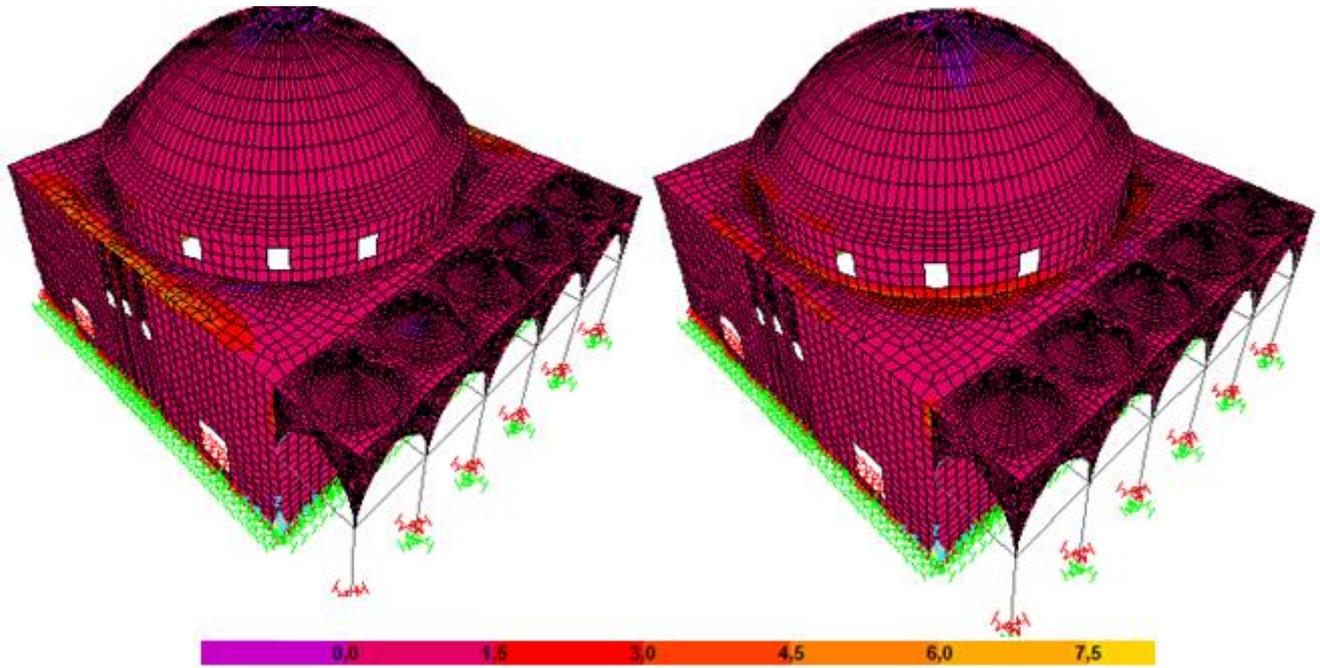


Figure 7: Maximum compression stresses contour diagram for outer and inner surfaces of the mosque with 16 window openings under dead load and earthquake load (G+EX).

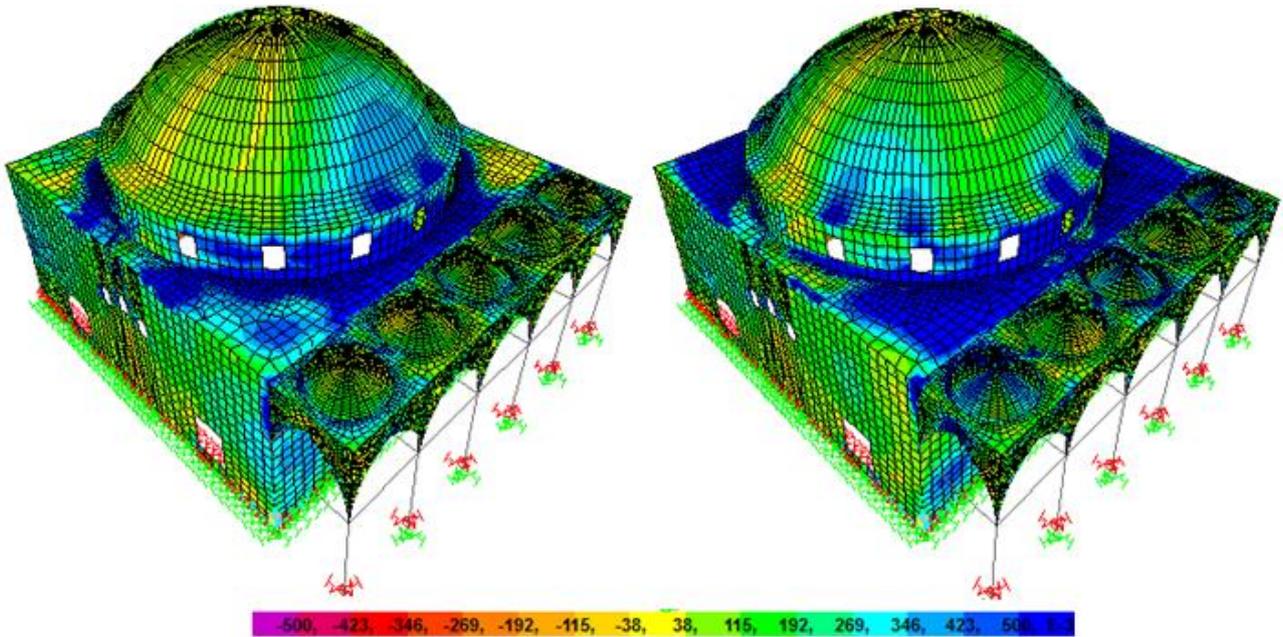

5 Figure 8: Maximum shear stresses contour diagram for outer and inner surfaces of the mosque with 16 window openings under dead load and earthquake load (G+EX).

3.1.3 Structural response of the mosque with 16 window openings under dead load and horizontal earthquake load (G+EY)

The maximum displacements contour diagram of Hüsrev Pasha Mosque with 16 window openings under dead load and earthquake load (G+EY) is shown in Fig. 9. It can be seen from the Figure 9 that the maximum displacement occurred at the middle point of the big dome as 44.0 mm. Beside this displacements have a decreasing trend from top of the dome to lower part of the mosque.

The maximum tensile stresses contour diagram is shown in Fig. 10. It is seen from the Figure 10 that maximum values of the tensile stresses for outer surface of the mosque occurred at side and lower part of big dome, near the window spaces and transition areas of between side walls as 0.95 MPa. Maximum tensile stresses for inner surface of the mosque occurred as 0.75 MPa.

The maximum compression stresses contour diagram is shown in Fig. 11. It is seen from the Figure 11 that maximum values of the compression stresses for outer surface of mosque occurred at between the dome and side walls transition areas and near window spaces at dome as 1.15 MPa. Beside this maximum compression stresses for inner surface of the mosque, occurred as 1.10 MPa.

The maximum shear stresses contour diagram for outer and inner surfaces of Hüsrev Pasha Mosque under dead load and earthquake load (G+EY) is shown in Fig. 12. It is seen from the Figure 12 that maximum values of the shear stresses for outer and inner surfaces of the mosque are 0.60 MPa and 0.55 MPa respectively.

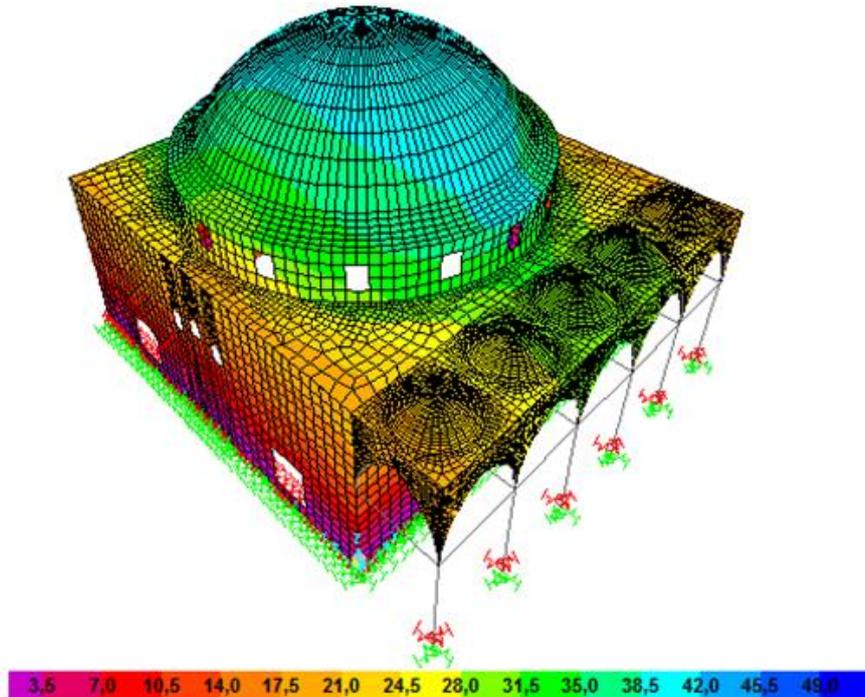


Figure 9: Maximum displacements contour diagram of the mosque with 16 window openings under dead load and earthquake load (G+EY).


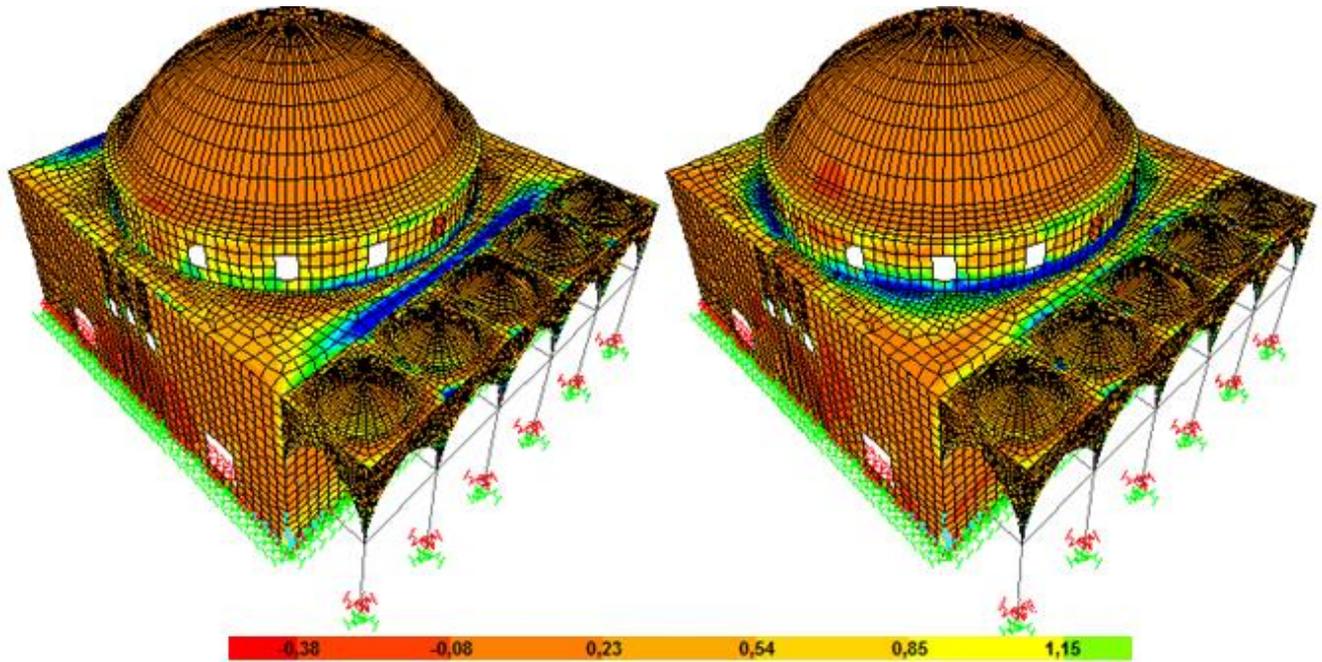


Figure 10: Maximum tensile stresses contour diagram for outer and inner surfaces of the mosque with 16 window openings under dead load and earthquake load (G+EY).

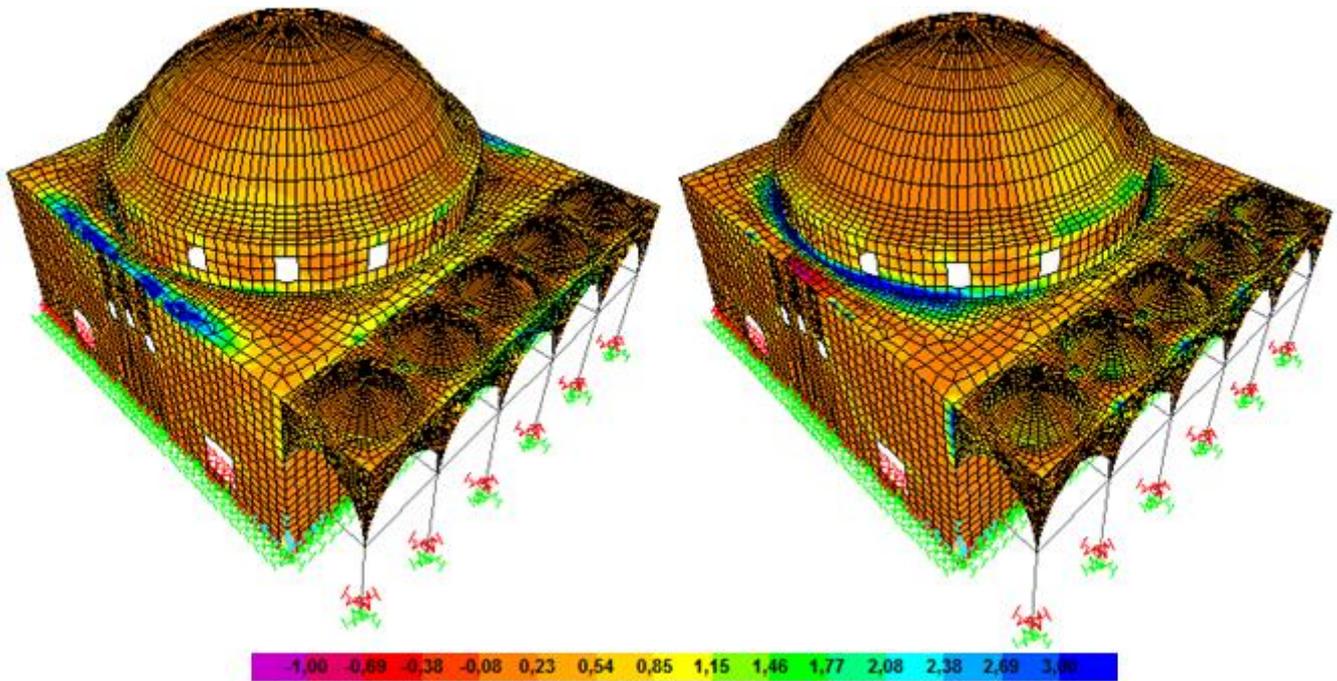

5 Figure 11: Maximum compression stresses contour diagram for outer and inner surfaces of the mosque with 16 window openings under dead load and earthquake load(G+EY).

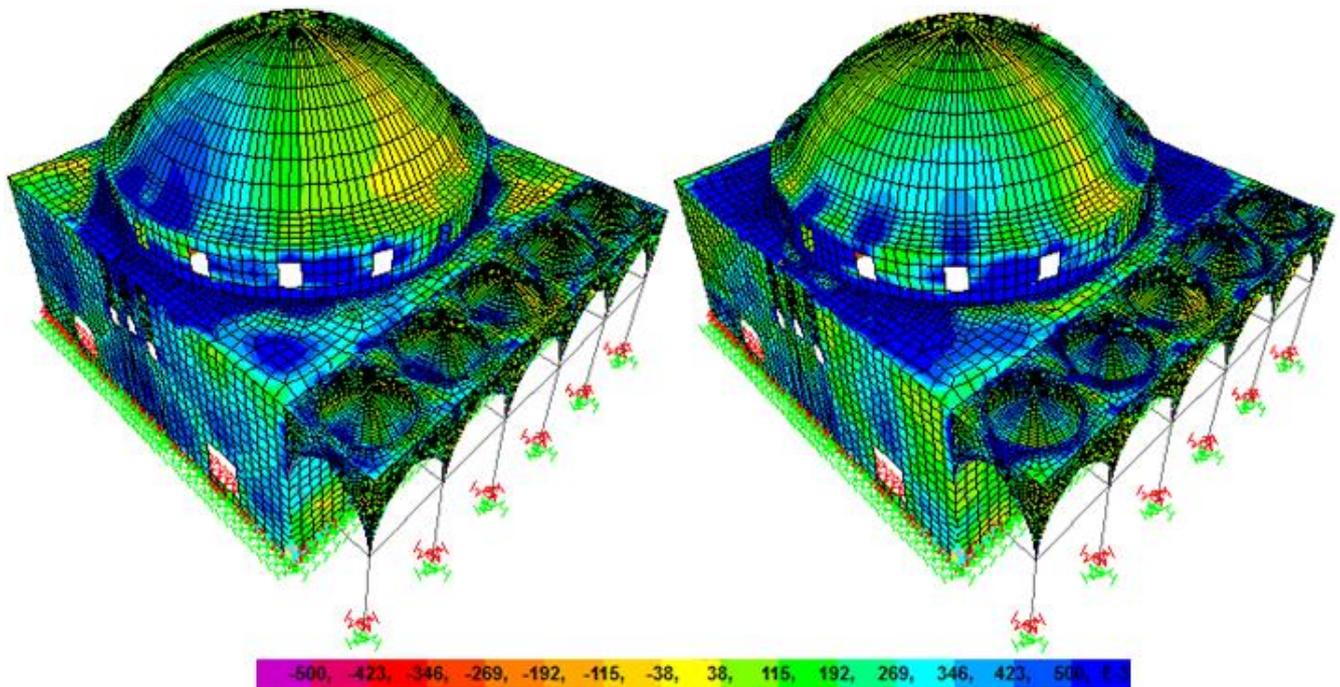


Figure 12: Maximum shear stresses contour diagram for outer and inner surfaces of the mosque with 16 window openings under dead load and earthquake load (G+EY).

3.1.4 Structural response of the mosque with 16 window openings under dead load and horizontal earthquake load (G+EZ)

The maximum displacements contour diagram of Hüsrev Pasha Mosque with 16 window openings under dead load and earthquake load (G+EZ) is shown in Fig. 13. It can be seen from the Figure 13 that the maximum displacement occurred at the middle point of the big dome as 19.6 mm. Beside this displacements have a decreasing trend from top of the dome to lower part of the mosque.

The maximum tensile stresses contour diagram is shown in Fig. 14. It is seen from the Figure 14 that maximum values of the tensile stresses for outer surface of the mosque occurred at side and lower part of big dome, near the window spaces and transition areas of between side walls as 0.85 MPa. Maximum tensile stresses for inner surface of the mosque occurred as 0.80 MPa.

The maximum compression stresses contour diagram is shown in Fig. 15. It is seen from the Figure 15 that maximum values of the compression stresses for outer surface of mosque occurred at between the dome and side walls transition areas and near window spaces at dome as 1.35 MPa. Beside this maximum compression stresses for inner surface of the mosque, occurred as 1.25 MPa.

The maximum shear stresses contour diagram for outer and inner surfaces of Hüsrev Pasha Mosque under dead load and earthquake load (G+EZ) is shown in Fig. 16. It is seen from the Figure 16 that maximum values of the shear stresses for outer and inner surfaces of the mosque are 0.50 MPa and 0.45 MPa respectively.


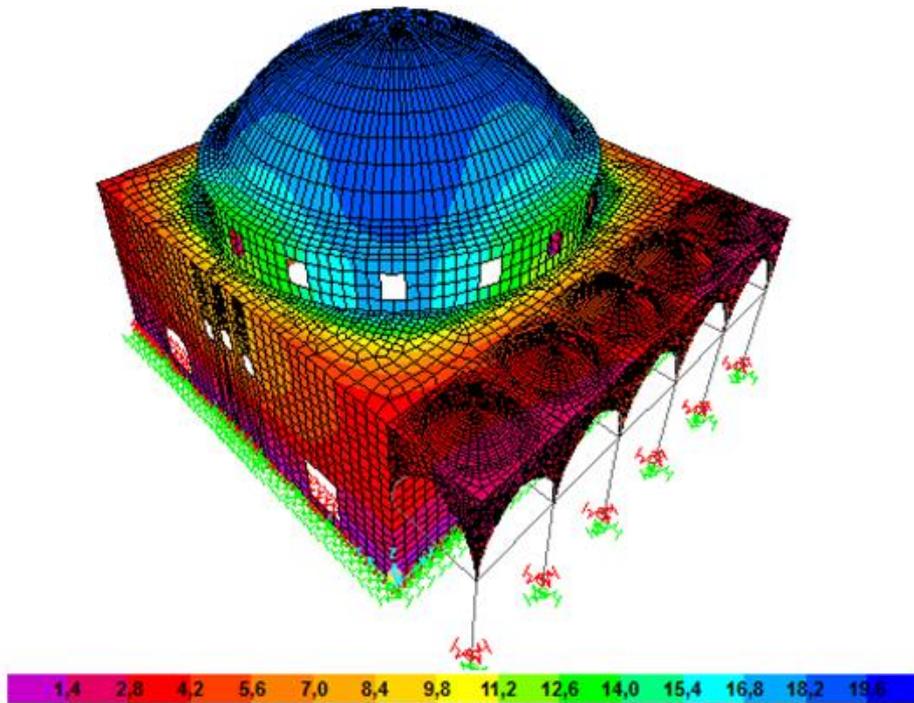


Figure 13: Maximum displacements contour diagram of the mosque with 16 window openings under dead load and earthquake load (G+EZ).

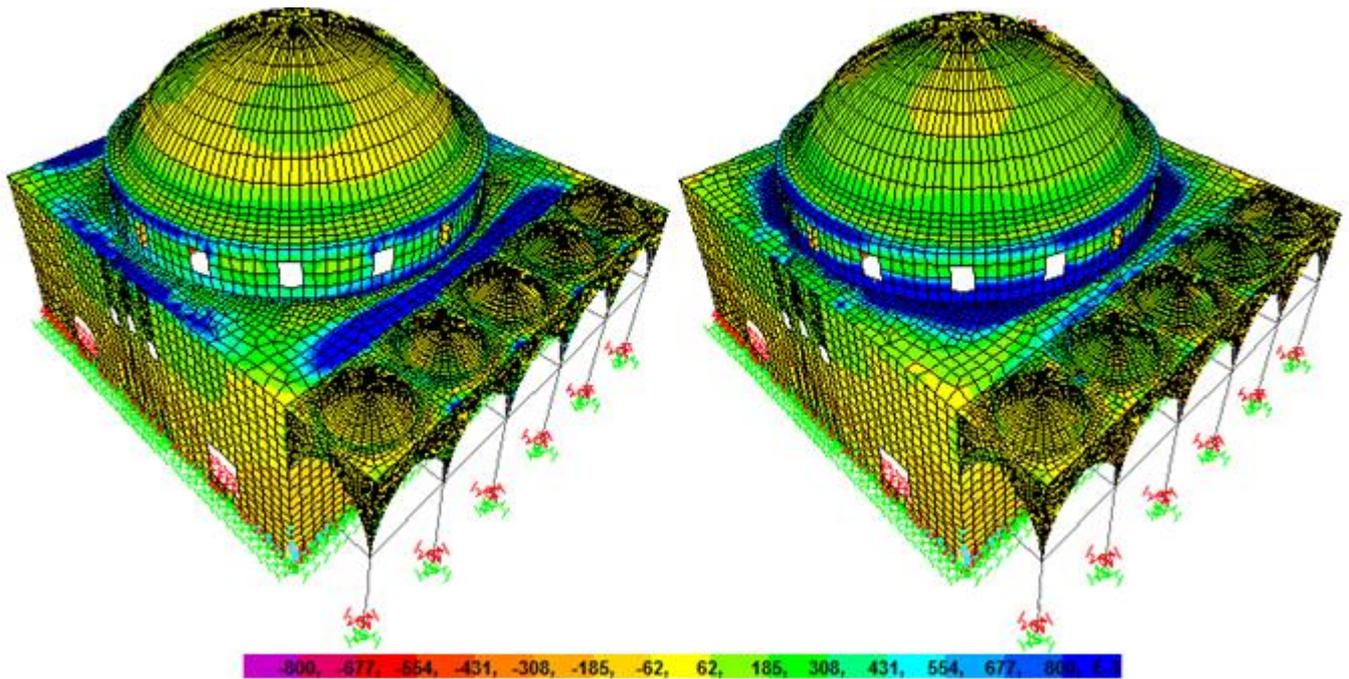

5 Figure 14: Maximum tensile stresses contour diagram for outer and inner surfaces of the mosque with 16 window openings under dead load and earthquake load (G+EZ).


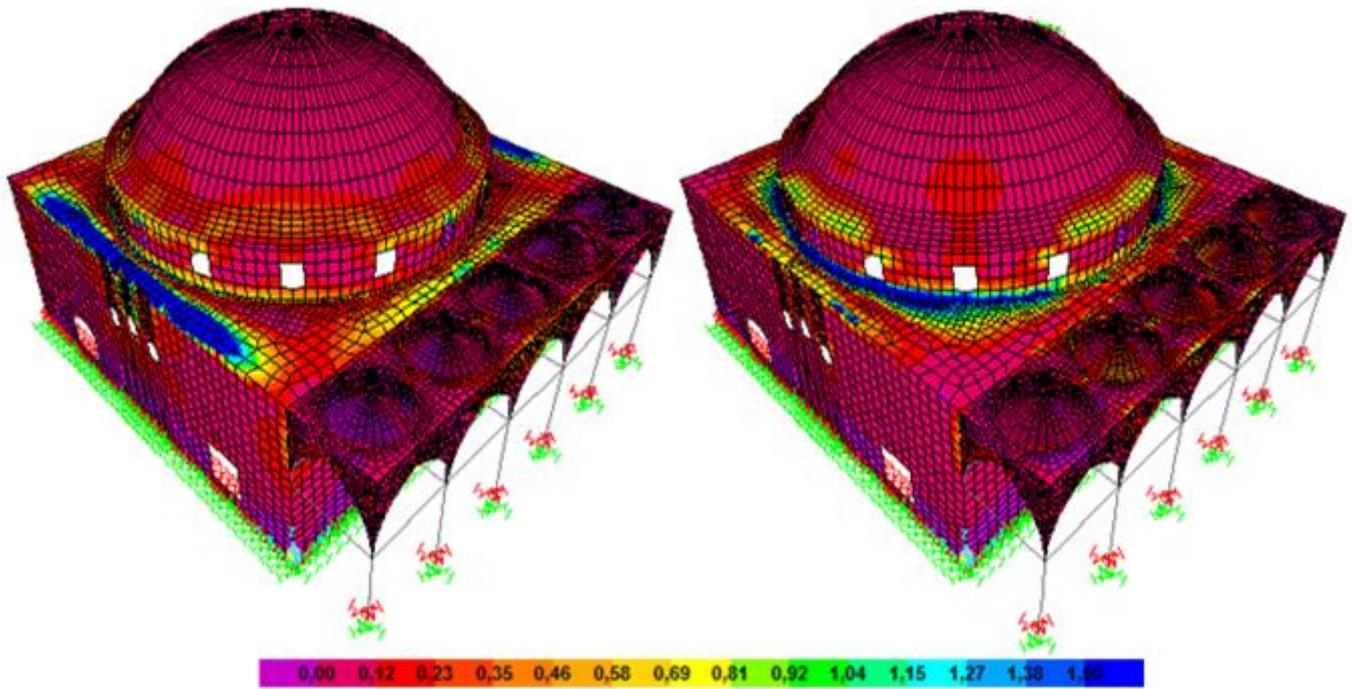


Figure 15: Maximum compression stresses contour diagram for outer and inner surfaces of the mosque with 16 window openings under dead load and earthquake load (G+EZ).

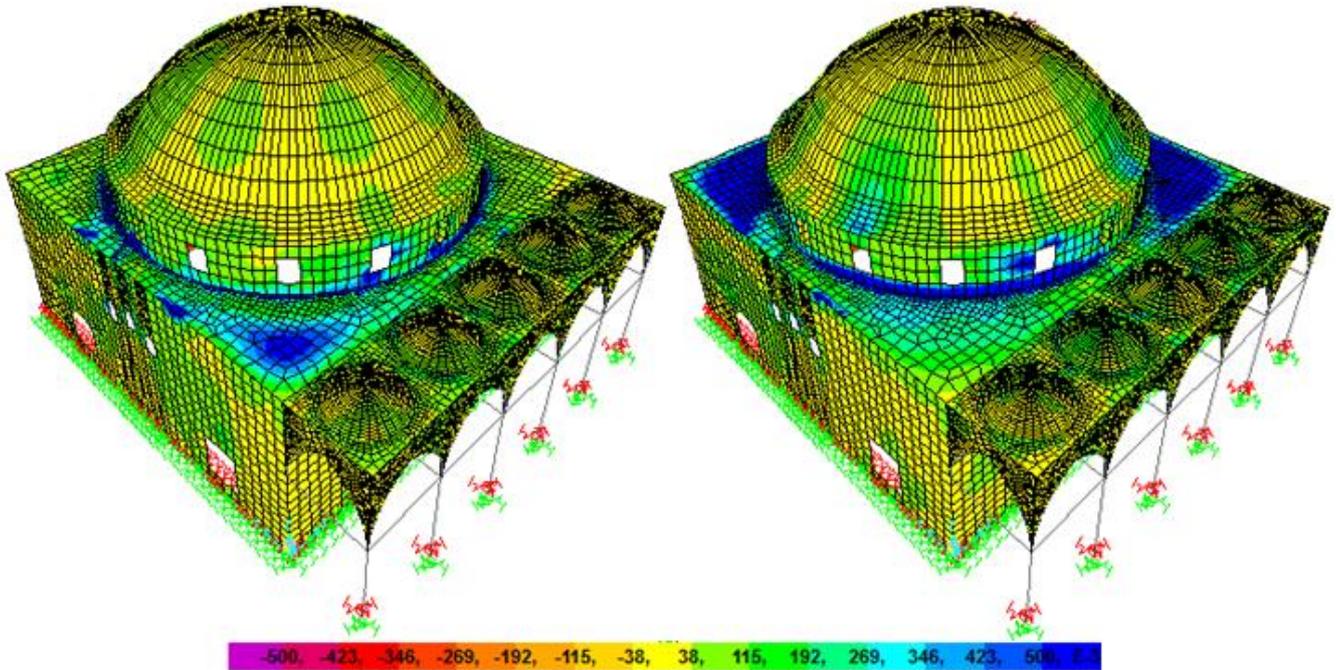

5 Figure 16: Maximum shear stresses contour diagram for outer and inner surfaces of the mosque with 16 window openings under dead load and earthquake load (G+EZ).

3.2 Structural analyses of the mosque with 8 window openings

The mosque has 8 window openings before the restoration case so finite element model of the mosque was constituted with 8 window openings. Finite element model of the mosque with 8 window openings is shown in Fig. 17. According to the modal analysis first four natural frequencies were obtained as 3.81Hz, 3.87Hz, 4.81Hz and 5.78Hz respectively. Mode shapes were obtained as translation X direction, translation Y direction, squeeze and torsion respectively. Results of earthquake analyses are given in Table 3.

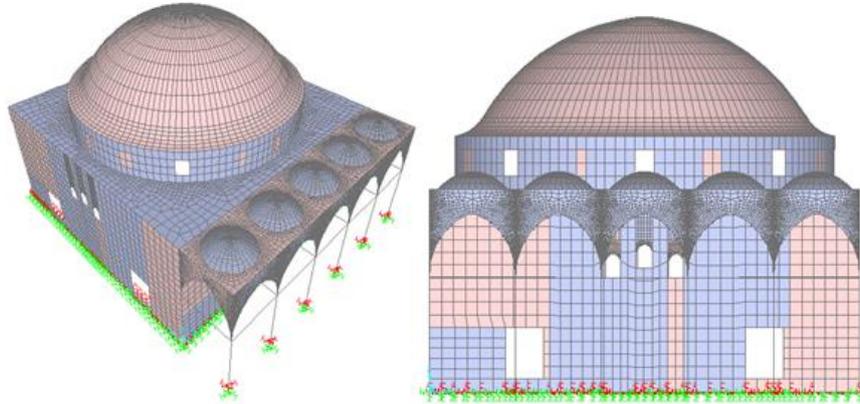


Figure 17: Finite element model of the mosque with 8 window openings.

Table 3 Whole analyses results of the mosque with 16 and 8 window openings

Analyses Data	Analyses						
	Dead and earthquake loads(X direction)		Dead and earthquake loads(Y direction)		Dead and earthquake loads(Z direction)		
	16 window	8 window	16 window	8 window	16 window	8 window	
Displacement(mm)	42.0	36.0	44.0	39.0	19.6	9.80	
Comp.	<i>Outer</i>	2.05	1.74	1.15	1.00	1.35	1.15
	<i>Inner</i>	1.85	1.51	1.10	0.95	1.25	1.05
Stresses (MPa)	<i>Outer</i>	1.05	0.95	0.95	0.80	0.85	0.69
	<i>Inner</i>	1.00	0.90	0.75	0.65	0.80	0.58
Shear	<i>Outer</i>	0.65	0.55	0.60	0.50	0.50	0.30
	<i>Inner</i>	0.60	0.50	0.55	0.45	0.45	0.20

10 4 Conclusions

In this study restoration effects on the earthquake behaviour of masonry mosques is investigated with considering different opening ratios on dome. As a result of the study the following observations were made:

- Reductions of window openings are caused an increase on frequencies. This situation shows that reduction of window openings affects the structural and stability of the mosque positively.
- When the stress results are examined it is seen that compression and shear stresses values don't exceed the recommended compression and shear stresses values for masonry structures in the Turkish Earthquake Code (2007).

- Tension stresses are occurred at near openings, bottom of walls and under the dome areas locally for each case.
 - Compression stresses, tension stresses and shear stresses collects some critic areas which are especially near openings and crossing points because of this, those areas must construct as monolithic in restoration process. FRP strengthening can be used for to resist the tension stresses in restoration applications.
- 5 • According to the results, the displacements, compression, tension and shear stresses decrease when the openings reduced.

Consequently, the reduction of window openings ensures integrity on the walls, so this situation supports the structural performance of the mosque. It is seen from the study that restoration applications, especially reduction of the window openings on dome are improves the earthquake response of the mosque.

10 References

- Chen, X. and Liu, Y.: Numerical study of in-plane behaviour and strength of concrete masonry infills with openings, *Eng. Struct.*, 82, 226–235, 2015.
- Chisari, C., Macorini, L., Amadio, C. and Izzuddin, B. A.: An inverse analysis procedure for material parameter identification of mortar joints in unreinforced masonry, *Comput. and Struct.*, 155, 97-105, 2015.
- 15 Lin, T. J. and LaFave, J.M.: Experimental structural behavior of wall-diaphragm connections for older masonry buildings, *Constr. Build. Mater.*, 26, 180-189, 2012.
- Mohebbkhah, A., Tasnimi, A. A. and Moghadam, H. A.: Nonlinear analysis of masonry-infilled steel frames with openings using discrete element method, *JCSR*, 64, 1463–1472, 2008.
- Parisi, F., Lignola, G. P., Augenti, N., Prota, A. and Manfredi, G.: Rocking response assessment of in-plane laterally-loaded
20 masonry walls with openings, *Eng. Struct.*, 56, 1234–1248, 2013.
- Salmanpour, A. H., Mojsilovic, N. and Schwartz, J.: Displacement capacity of contemporary unreinforced masonry walls: An experimental study, *Eng. Struct.*, 89, 1-16, 2015.
- SAP2000, Computers and Structures Inc. Berkeley, California, USA; 2015.
- Shariq, M., Abbas, H., Irtaza, H. and Qamaruddin, M.: Influence of openings on seismic performance of masonry building
25 walls, *Build. Environ.*, 43, 1232–1240, 2008.
- TEC, Specification for Buildings to be Built in Seismic Zones, Ministry of Public Works and Settlement, General Directorate of Disaster Affairs, Earthquake Research Department, Ankara, Turkey, 2007
- URL-1: <http://www.merkurhaber.com/van-husrev-pasa-camii-ve-kulliyesi-p6-aid,621.html#galeri>, last access 20 July 2015.